Frame Member Schedule

Part	Mem.	Width	Thick.	Webthk	Depth1	Depth2	Approx. Lgth
CBX006	1001	127	6.35	6.35	305	305	1849
CX026	1	229	9.52	4.18	250	250	6002
RBX033	2	305	9.52	3.42	500	500	9445
	3	305	9.52	3.42	500	500	
FCX002		152	4.76	3.42	216	216	610
TCX001		102mm X 102mm X 8mm SQUARE TUBE COLUMN					2934

A325 Bolt Connection & Plate Schedule

Id	Qty	Bolt Dia.	Bolt Length	Plate Thick.	Rows Out	Rows In	Tension Bolt	Washer
A	4	19	51	10	1	1		
B	4	19	51	10	2	-		
C	4	25	51	19	1	1		
D	4	19	51	10	1	1		
E	4	19	51	19	1	1		

Frame Clearances
Vert. Clearance at member 1(CX026): 6002
Finished Floor Elevation = 100000 (Unless Noted Otherwise)

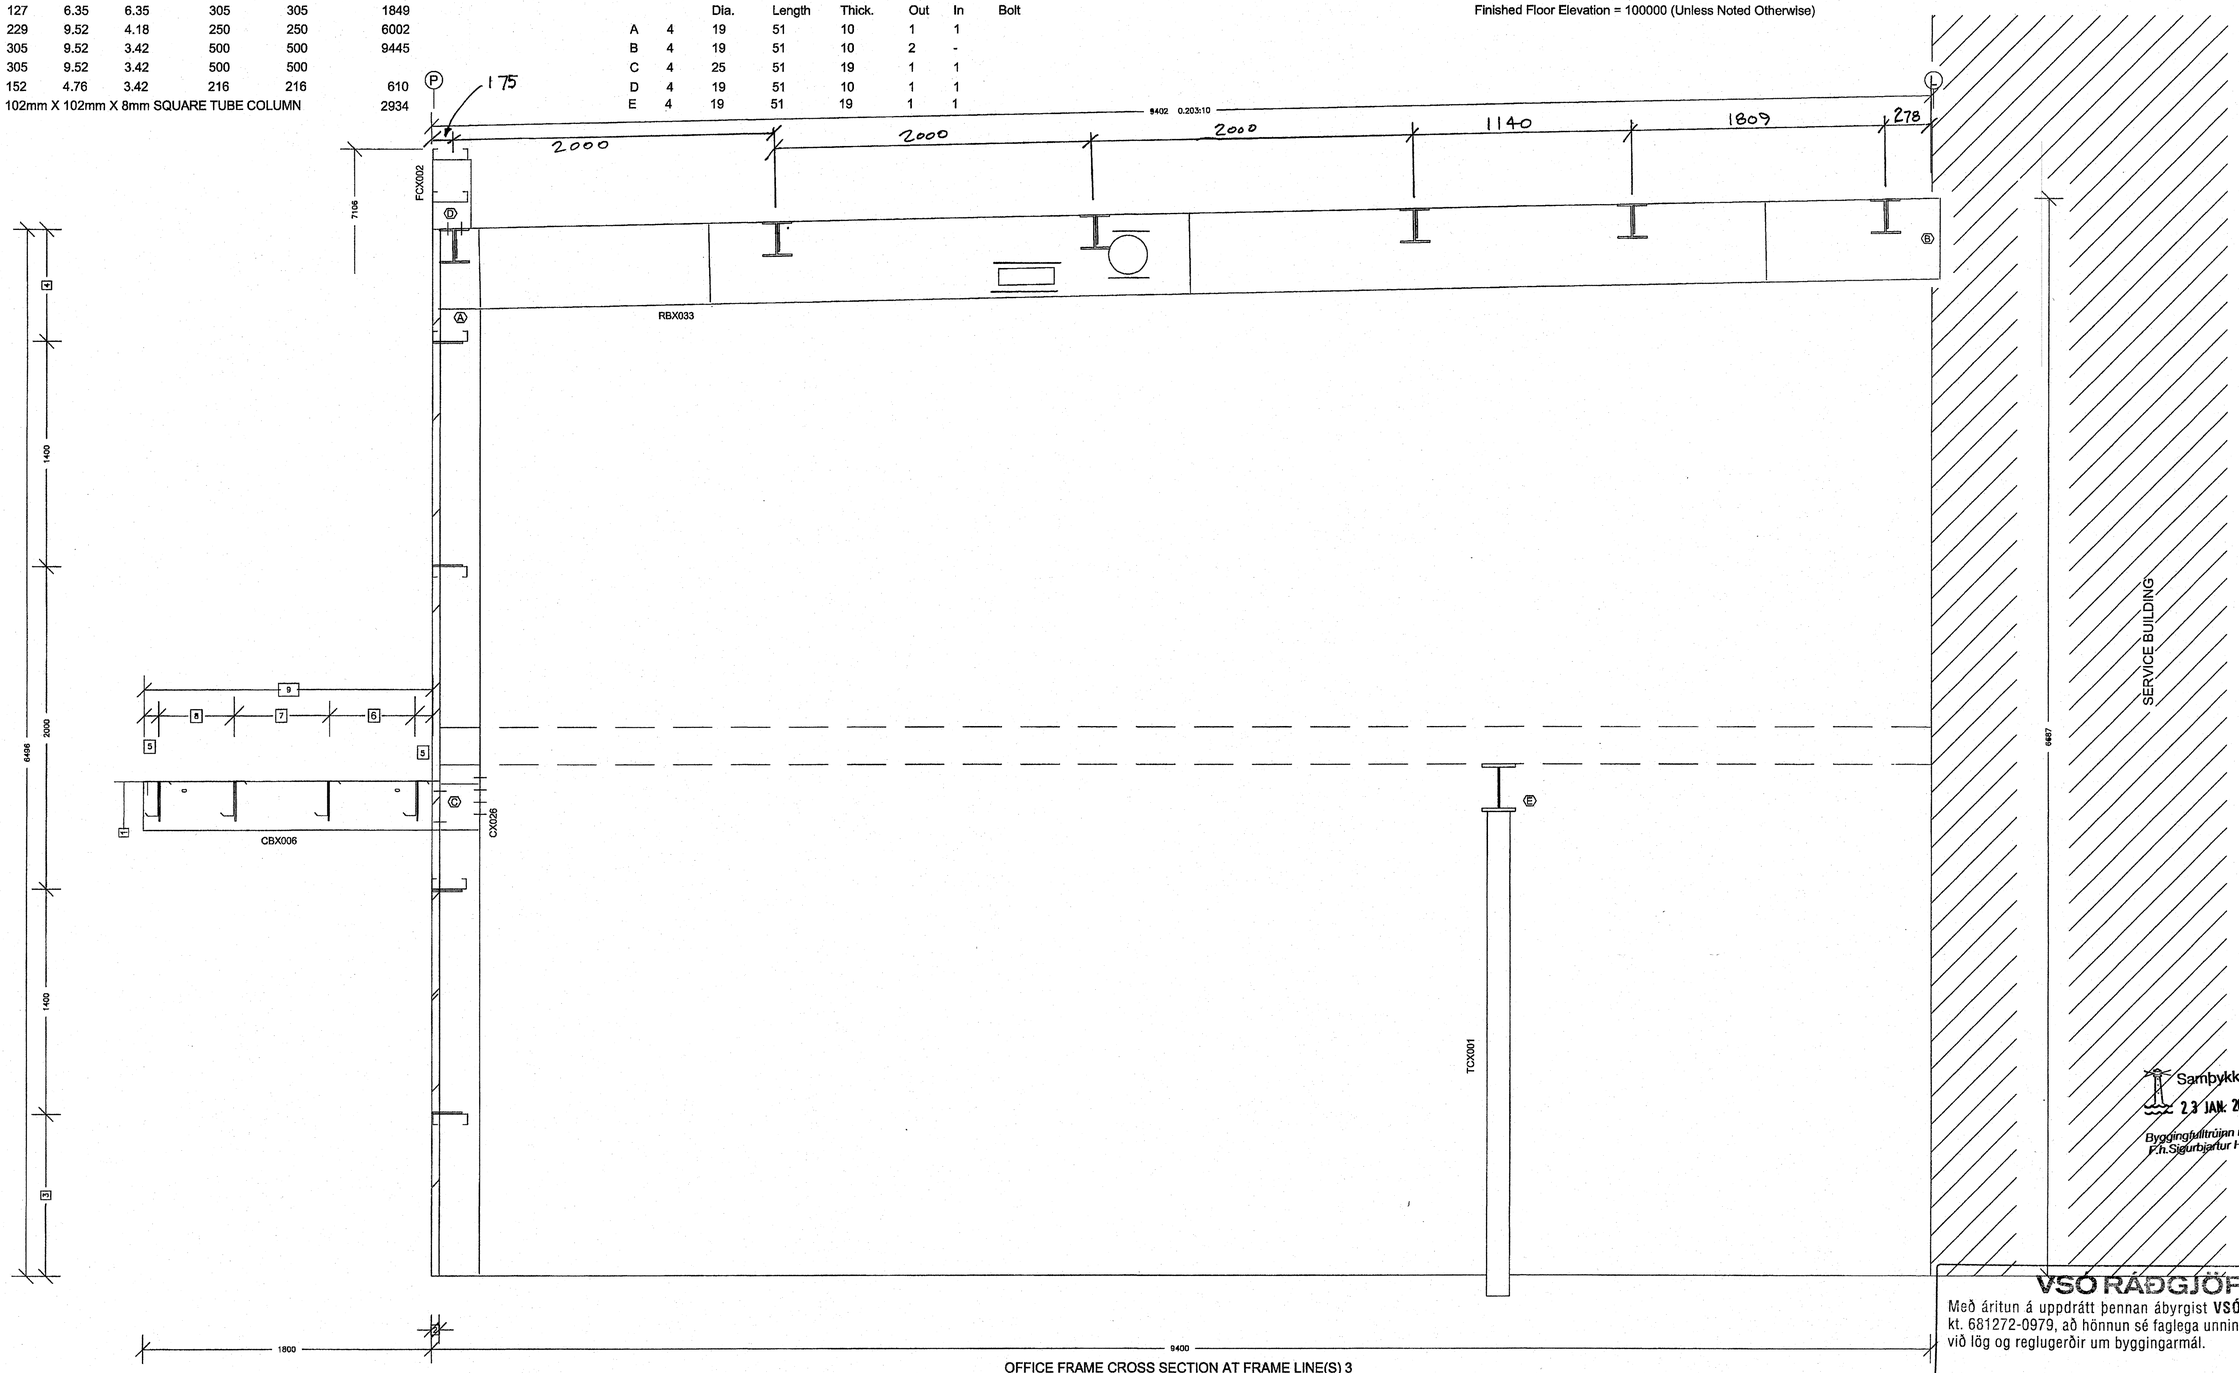

9 1800 0.012:10
8 497
7 571
6 554
5 89
4 695
3 1000
2 49
1 2750

Dimension Key

OFFICE FRAME CROSS SECTION AT FRAME LINE(S) 3

VP Ref: Shape Name = Office area Wall 6, Frame 2

Norðurhella 2 · 221 Hafnarfjörður

Samþykkt þann 23 JAN. 2008
Byggingafulltrúinn í Hafnarfirði
F.h. Sigurbjartur Halldórsson

VSÓ RÁÐGJÖF
Með áritun á uppdrátt þennan ábyrgist VSÓ Ráðgjöf ehf. kt. 681272-0979, að hönnun sé faglega unnin og í samræmi við lög og reglugerðir um byggingarmál.

Dags.	Nafn	Kennitala

1. USE 1/2 X 1 1/2 A325 SNUG TIGHTENED BOLTS FOR PURLIN TO FRAME, GIRT TO FRAME, AND GIRT TO CLIP CONNECTIONS UNLESS NOTED OTHERWISE.
2. SLOT REINFORCEMENT PLATES NEED NOT BE LOCATED ON THE SAME SIDE OF THE WEB AS THE HILLSIDE WASHER.

THE VP ENGINEER'S SEAL APPLIES ONLY TO THE WORK PRODUCT OF VP AND DESIGN AND PERFORMANCE REQUIREMENTS SPECIFIED BY VP. THE VP ENGINEER'S SEAL DOES NOT APPLY TO THE PERFORMANCE OR DESIGN OF ANY OTHER PRODUCT OR COMPONENT FURNISHED BY VP EXCEPT TO ANY DESIGN OR PERFORMANCE REQUIREMENTS SPECIFIED BY VP.

THIS DRAWING, INCLUDING THE INFORMATION HEREON, REMAINS THE PROPERTY OF VP BUILDINGS.

IT IS PROVIDED SOLELY FOR ERECTING THE BUILDING DESCRIBED IN THE APPLICABLE PURCHASE ORDER AND SHALL NOT BE MODIFIED, REPRODUCED OR USED FOR ANY OTHER PURPOSE WITHOUT PRIOR WRITTEN APPROVAL OF VP BUILDINGS.

THE GENERAL CONTRACTOR AND/OR ERECTOR IS SOLELY RESPONSIBLE FOR ACCURATE, GOOD QUALITY WORKMANSHIP IN ERECTING THIS BUILDING IN CONFORMANCE WITH THIS DRAWING, DETAILS REFERENCED IN THIS DRAWING, ALL APPLICABLE VP ERECTION GUIDES, AND INDUSTRY STANDARDS PERTAINING TO PROPER ERECTION, INCLUDING THE CORRECT USE OF TEMPORARY BRACING.

VP Buildings, Inc.
3200 Players Club Circle Memphis TN 38125

REV	DATE	BY	DESCRIPTION

NTS

FOR CONSTRUCTION

OFFICE FRAME CROSS SECTION AT FRAME LINE(S) 3

Norðurhella 2 - Hafnarfirði
Stálrammi í línu 3
Skrifstofuhluti
Bl. nr. 23

VP BUILDINGS
VARCO-PRUDEN

VPC VERSION: 5.6d

JOBNO	07-4487
DATE	8/14/2007
DRAWN/CHECK	ELM ELM
PAGE	23

8/3/2007 9:01:43

FILENAME: 07-4487-EP2-Office&Mezzanine.VPC

Verkfræðistofa Hauks Ásgeirssonar ehf.
VHA
Kt. 560600-3050
Dalvegi 18
201 Kópavogur

EYKT
26 OCT 2007
MOTTEKIÐ