


Frame Member Schedule

Part	Mem.	Width	Thick.	Webthk	Depth1	Depth2	Approx. Lgth	Detail	Mark No
CX005	1	203	19.05	6.35	305	1321	4234		
RBX008	2	203	15.88	6.35	1067	1064	5688		
	3	203	15.88	4.76	1064	1067			
	4	203	9.52	4.76	1067	864			
RBX009	5	127	9.52	4.18	864	864	9845		
	6	127	6.35	4.18	864	305			
	7	127	4.76	3.42	305	559			
CX006	8	203	15.88	4.18	305	711	8684		
ICX002	9	152	12.70	4.18	406	406	6218		

A325 Bolt Connection & Plate Schedule

Id	Qty	Bolt Dia.	Bolt Length	Plate Thick.	Rows Out	Rows In	Tension Bolt	Washer
A	12	19	63	19	3	3		
B	10	19	51	13	3	2		
C	4	19	57	16	1	1		

Frame Clearances
 Horiz. Clearance between members 1 (CX005) and 8 (CX006): 13768
 Vert. Clearance at member 1 (CX005): 4234
 Vert. Clearance at member 8 (CX006): 7949
 Vert. Clearance at member 9 (ICX002): 6130
 Finished Floor Elevation = 100000 (Unless Noted Otherwise)

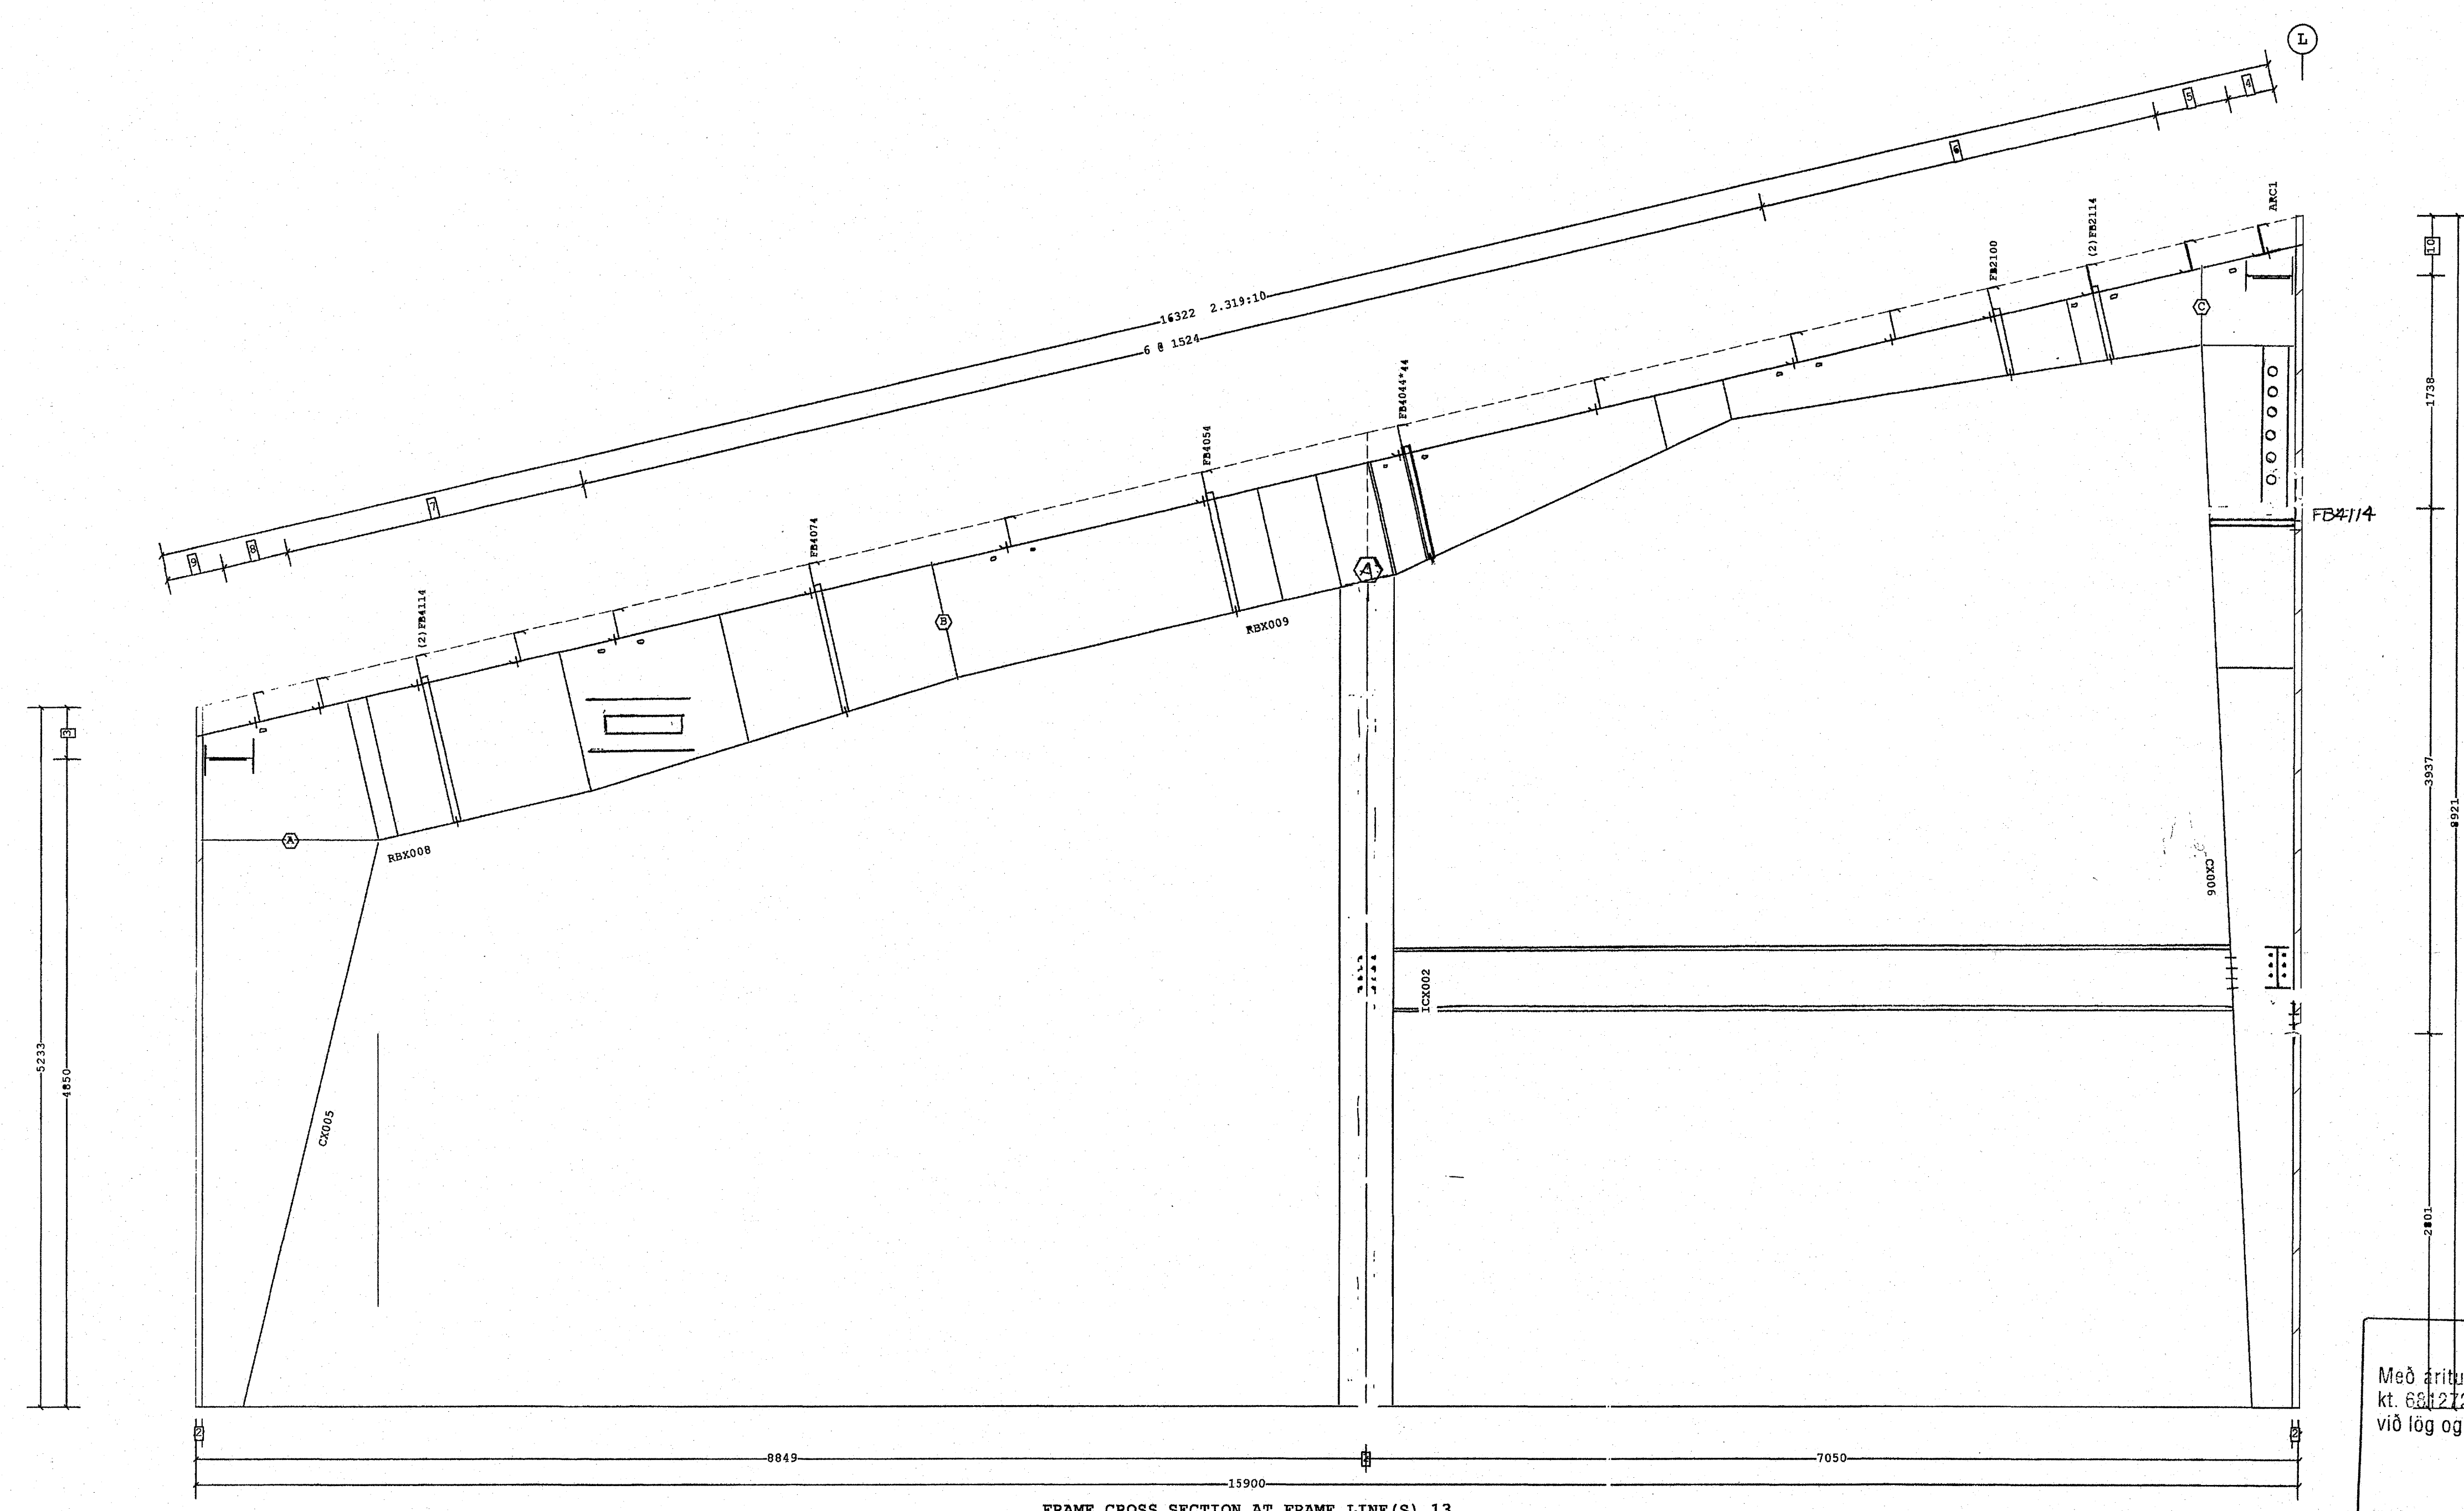

Dimension Key

10	445
9	438
8	492
7	3 @ 762
6	4 @ 762
5	560
4	354
3	383
2	50
1	1

FRAME CROSS SECTION AT FRAME LINE(S) 13

FB or SFB with * must use bearing plate JCP051140 (see Detail BR25D1)

VP Ref: Shape Name = Service Building Wall 2, Frame 3

- USE 1/2 X 1 1/2 A325 SNUG TIGHTENED BOLTS FOR PURLIN TO FRAME, GIRT TO FRAME, AND GIRT TO CLIP CONNECTIONS UNLESS NOTED OTHERWISE.
- SLOT REINFORCEMENT PLATES NEED NOT BE LOCATED ON THE SAME SIDE OF THE WEB AS THE HILLSIDE WASHER.

THE VP ENGINEER'S SEAL APPLIES ONLY TO THE WORK PRODUCT OF VP AND DESIGN AND PERFORMANCE REQUIREMENTS SPECIFIED BY VP. THE VP ENGINEER'S SEAL DOES NOT APPLY TO THE PERFORMANCE OR DESIGN OF ANY OTHER PRODUCT OR COMPONENT FURNISHED BY VP EXCEPT TO ANY DESIGN OR PERFORMANCE REQUIREMENTS SPECIFIED BY VP.

THIS DRAWING, INCLUDING THE INFORMATION HEREON, REMAINS THE PROPERTY OF VP BUILDINGS. IT IS PROVIDED SOLELY FOR ERECTING THE BUILDING DESCRIBED IN THE APPLICABLE PURCHASE ORDER AND SHALL NOT BE MODIFIED, REPRODUCED OR USED FOR ANY OTHER PURPOSE WITHOUT PRIOR WRITTEN APPROVAL OF VP BUILDINGS.

THE GENERAL CONTRACTOR AND/OR ERECTOR IS SOLELY RESPONSIBLE FOR ACCURATE, GOOD QUALITY WORKMANSHIP IN ERECTING THIS BUILDING IN CONFORMANCE WITH THIS DRAWING, DETAILS REFERENCED IN THIS DRAWING, ALL APPLICABLE VP ERECTION GUIDES, AND INDUSTRY STANDARDS PERTAINING TO PROPER ERECTION, INCLUDING THE CORRECT USE OF TEMPORARY BRACING.


VP Buildings, Inc.
 3200 Players Club Circle Memphis TN 38125

REV	DATE	BY	DESCRIPTION

NTS
 8/9/2007 15:47:10

FRAME CROSS SECTION AT FRAME LINE(S) 13

Norðurhella 2 - Hafnarfirði
 Stálrammi í línu 13
 Verkstæðishluti
 Bl. nr. 10

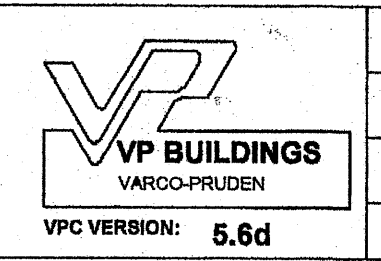

JOBNO	07-4487
DATE	8/9/07
DRAWN/CHKD	DJS / DJS
PAGE	10

Samþykkt þann 23 JAN. 2008
 Byggingfulltrúinn í Hafnarfirði
 F.h. Sigurbjartur Halldórsson

VSÓ RÁÐGJÖF
 Með áritun á uppdrátt þennan ábyrgist VSÓ Ráðgjöf ehf. kt. 63222-0979, að hönnun sé faglega unnin og í samræmi við lög og reglugerðir um byggingarmál.

Dags. _____ Nafn _____ Kennitala _____

FOR CONSTRUCTION
 Norðurhella 2 - 221 Hafnarfjörður