


Wall Liner Schedule

| Id | Qty | Type | Length | Gage | OP | Fin. | Color | Direction |
|-----|-----|------|------------|------|----|------|-------|---------------|
| #12 | 18 | FR | 17'-4 3/8" | 26 | D | K | RW | Left to Right |
| #29 | 18 | FR | 2'-3 1/8" | 26 | 1 | K | RW | Left to Right |

Oper. Code: D=SQ, RT
 Oper. Code: I=SQ, SQ
 Finish: K=KXL
 Color: RW=Cool Regal White

Trim Schedule

| Id | Parts | Color | Details |
|----|---|------------------|--------------------------------|
| T1 | (3) GAC1024, (5) NLTA10, NLTA05, (2) CLA1033R, CLA1032R, (14) CLA1072R, (12) CLA2102R, (2) CLA1020R, CLA1064R | Cool Regal White | RC80A2, RC80A3, RC80C1, WC12A2 |
| T2 | HT10 | Cool Regal White | WC80A1, WC80B2, WC80C2, WC80D2 |
| T3 | HT10, CLD3024R, CLC7044R | Cool Regal White | WC80A1, WC80B2, WC80C2, WC80D2 |
| T4 | (7) JT10 | Cool Regal White | WC61A9 |
| T5 | (5.2) HT10 | Cool Regal White | |
| T6 | (6) HT14, (2) HT12, (17.4) 80140 | Cool Regal White | |

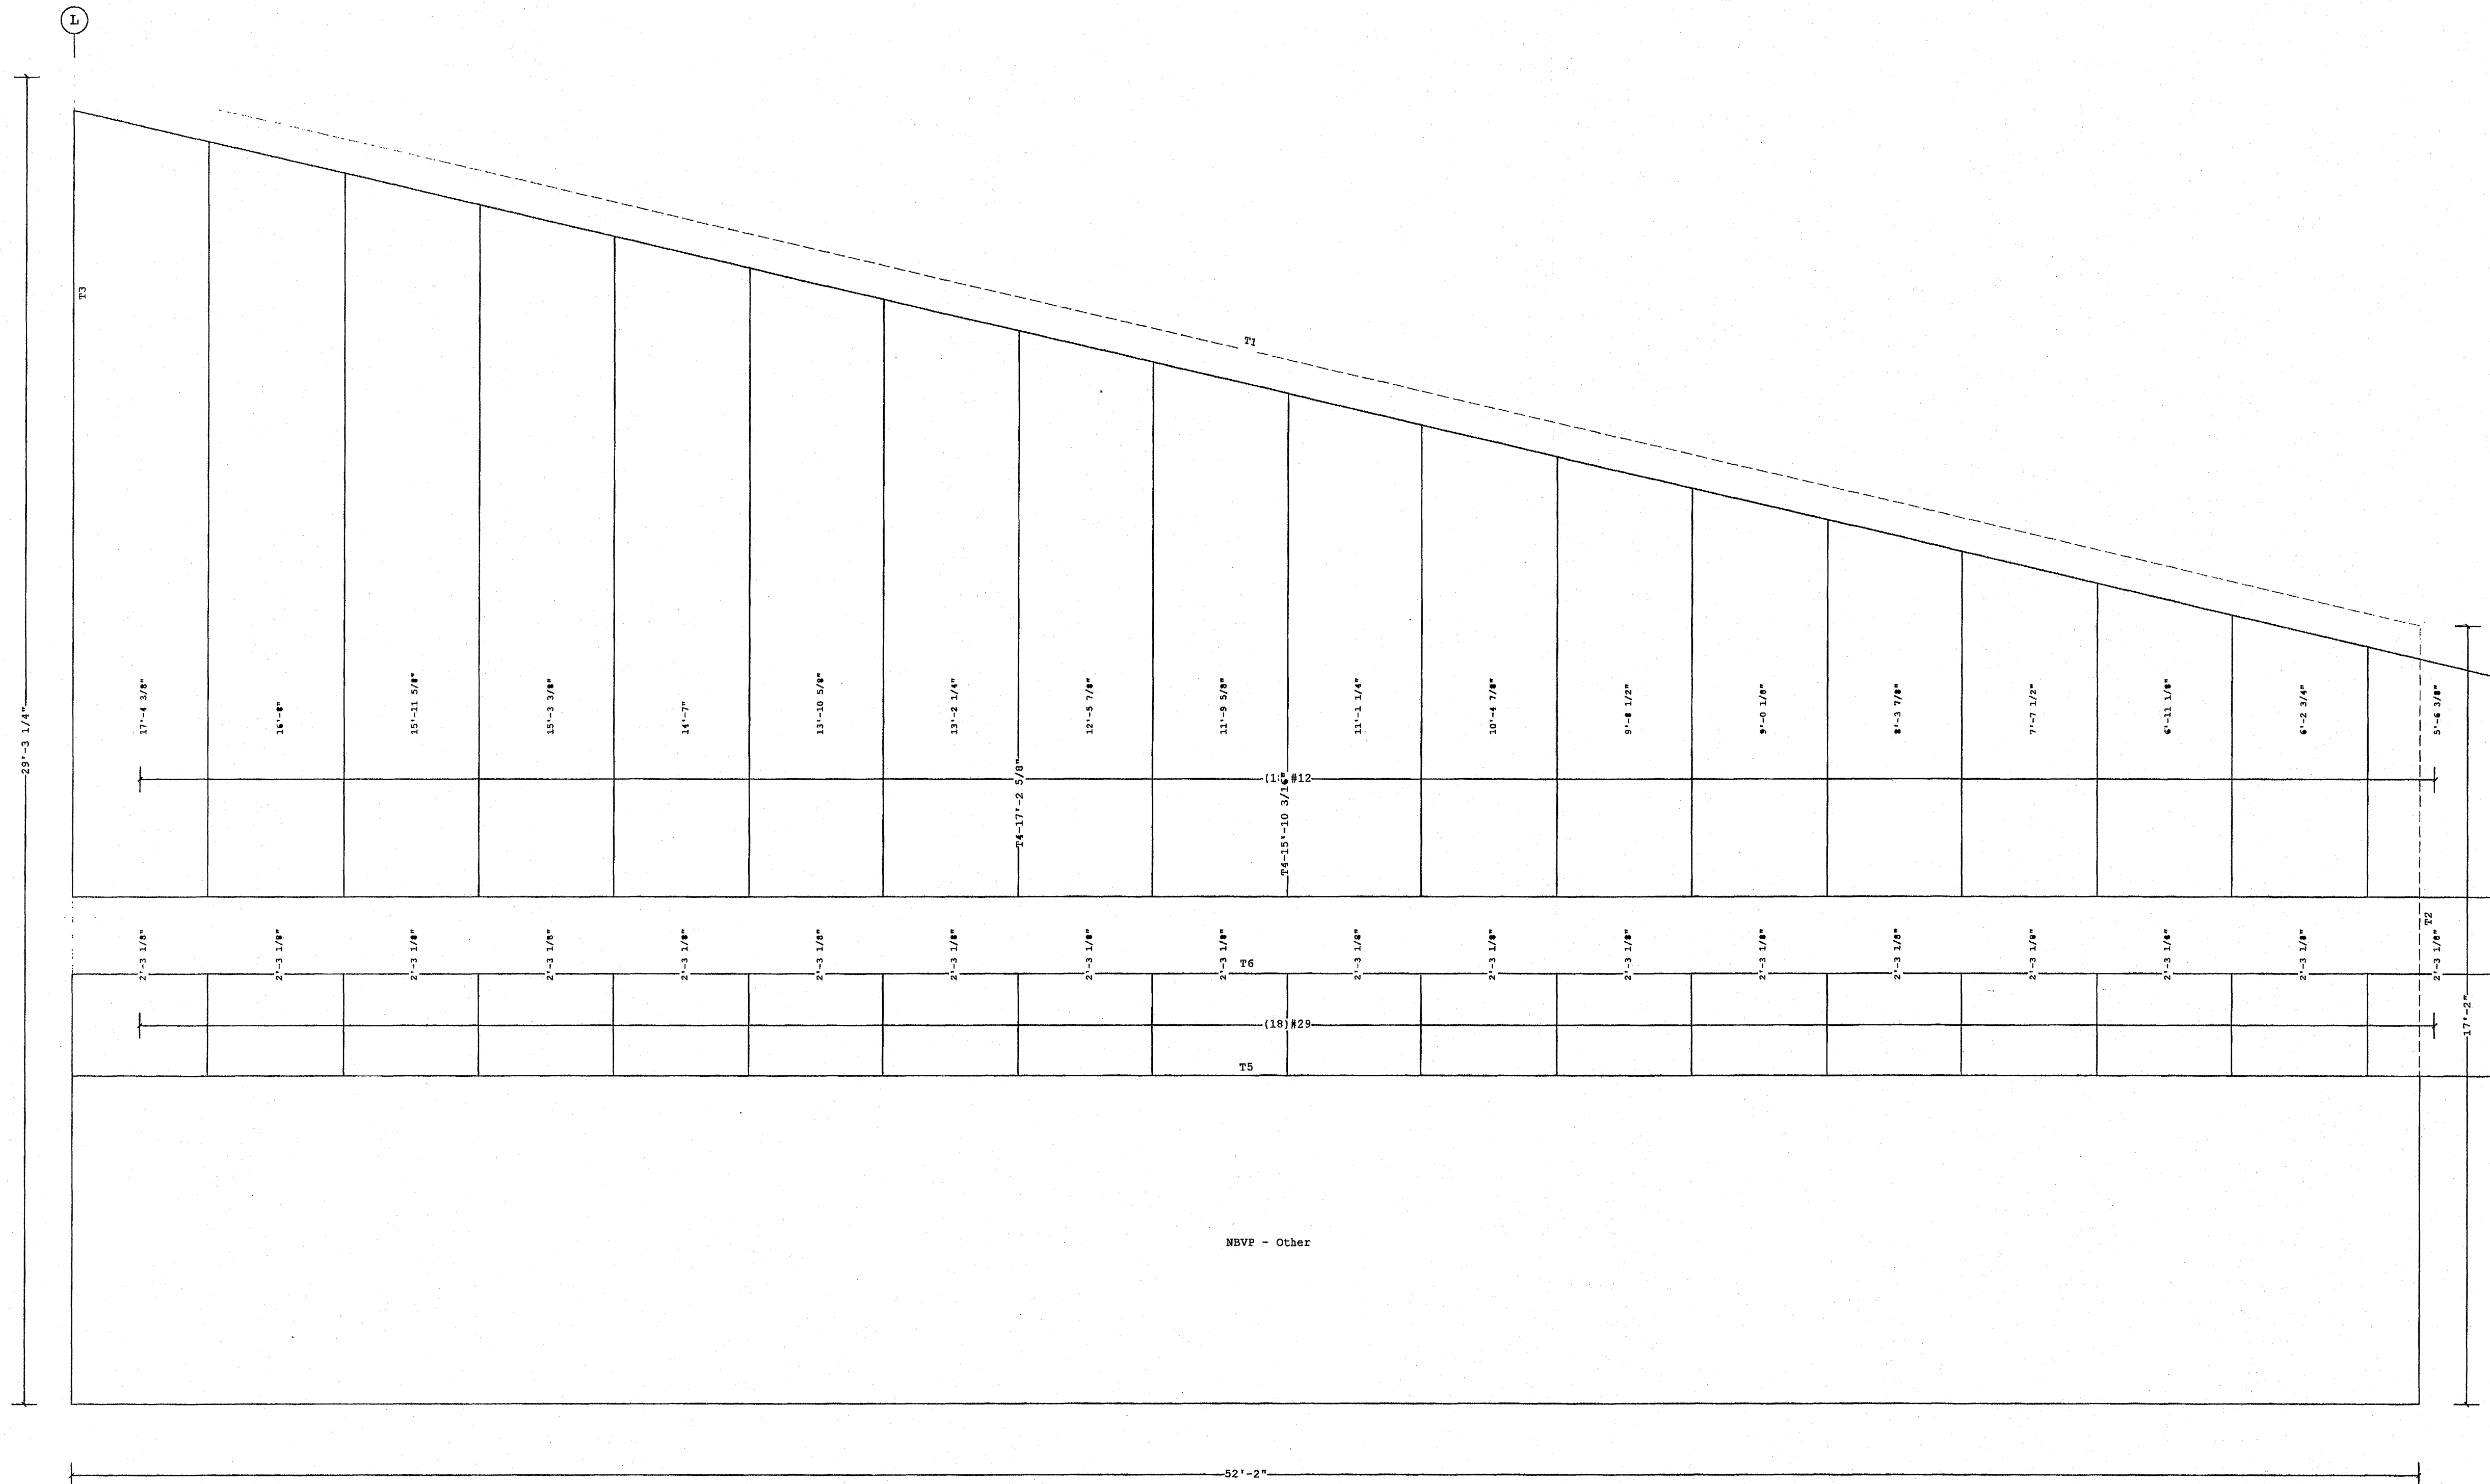

WALL LINER ELEVATION PARTITION OR MISC. 5
(View from inside Building)

Norðurhella 2 · 221 Hafnarfjörður

FOR CONSTRUCTION

- PRE-DRILLING 1/8 DIAMETER HOLES FOR WALL STRUCTURAL FASTENERS MAY BE REQUIRED AT 11 GAGE GIRTS, NESTED GIRTS, GIRT LAP LOCATIONS, AND/OR SECONDARY STRUCTURAL BEAMS
- PANELS SHOWN WITH A LENGTH LESS THAN 1-0, 5-0 FOR SSR, MAY HAVE TO BE FIELD CUT.
- SEE JOB DETAILS FOR SHEETING AND TRIM FASTENER SPECIFICATION.

THE VP ENGINEER'S SEAL APPLIES ONLY TO THE WORK PRODUCT OF VP AND DESIGN AND PERFORMANCE REQUIREMENTS SPECIFIED BY VP. THE VP ENGINEER'S SEAL DOES NOT APPLY TO THE PERFORMANCE OR DESIGN OF ANY OTHER PRODUCT OR COMPONENT FURNISHED BY VP EXCEPT TO ANY DESIGN OR PERFORMANCE REQUIREMENTS SPECIFIED BY VP.

THIS DRAWING, INCLUDING THE INFORMATION HEREON, REMAINS THE PROPERTY OF VP BUILDINGS. IT IS PROVIDED SOLELY FOR ERECTING THE BUILDING DESCRIBED IN THE APPLICABLE PURCHASE ORDER AND SHALL NOT BE MODIFIED, REPRODUCED OR USED FOR ANY OTHER PURPOSE WITHOUT PRIOR WRITTEN APPROVAL OF VP BUILDINGS.

THE GENERAL CONTRACTOR AND/OR ERECTOR IS SOLELY RESPONSIBLE FOR ACCURATE, GOOD QUALITY WORKMANSHIP IN ERECTING THIS BUILDING IN CONFORMANCE WITH THIS DRAWING, DETAILS REFERENCED IN THIS DRAWING, ALL APPLICABLE VP ERECTION GUIDES, AND INDUSTRY STANDARDS PERTAINING TO PROPER ERECTION, INCLUDING THE CORRECT USE OF TEMPORARY BRACING.

VP Buildings, Inc.
3200 Players Club Circle Memphis TN 38125

| REV | DATE | BY | DESCRIPTION |
|-----|------|----|-------------|
| | | | |
| | | | |
| | | | |
| | | | |

8/9/2007 13:29:26

WALL LINER ELEVATION PARTITION OR MISC. 5

Norðurhella 2 - Hafnarfjörði
Klæðning á millivegg 5
Verkstæðishluti
Bl. nr. 62

| | |
|-------------|---------|
| JOBNO | 07-4407 |
| DATE | 8-9-07 |
| DRAWN/CHECK | SSS |
| PAGE | 62 |

VP BUILDINGS
VARCO-PRUDEN
VPC VERSION: 5.0d

Verkfæðistofa Hauks Ásgeirssonar ehf.
Kt. 560600-3050
Dalvegji 18
201 Kópavogur

Með áritun á uppdrátt þennan ábyrgist VSÓ Ráðgjöf ehf. kt. 661272-0979, að hönnun sé faglega unnin og í samræmi við lög og reglugerðir um byggingarmál.

Samþykkt þann
23 JAN. 2008
Byggingfulltrúinn í Hafnarfjörði
F.h. Sigurbjartur Halldórsson
EYKT
26 OCT 2007
MOTLEK