


| Frame Member Schedule | | | | | | | |
|-----------------------|------|--|--------|--------|--------|--------|--------------|
| Part | Mem. | Width | Thick. | Webthk | Depth1 | Depth2 | Approx. Lgth |
| CBX006 | 1001 | 127 | 6.35 | 6.35 | 305 | 305 | 1849 |
| CX027 | 1 | 254 | 9.52 | 4.18 | 250 | 250 | 6002 |
| RBX034 | 2 | 279 | 12.70 | 4.76 | 500 | 500 | 9445 |
| | 3 | 279 | 12.70 | 4.76 | 500 | 500 | |
| FCX002 | | 152 | 4.76 | 3.42 | 216 | 216 | 610 |
| TCX001 | | 102mm X 102mm X 8mm SQUARE TUBE COLUMN | | | | | 2934 |

| CA325 Bolt Connection & Plate Schedule | | | | | | | | | |
|--|-----|-----------|-------------|--------------|----------|---------|--------------|--------|--|
| Id | Qty | Bolt Dia. | Bolt Length | Plate Thick. | Rows Out | Rows In | Tension Bolt | Washer | |
| A | 4 | 19 | 51 | 13 | 1 | 1 | | | |
| B | 4 | 19 | 51 | 10 | 2 | - | | | |
| C | 4 | 25 | 51 | 19 | 1 | 1 | | | |
| D | 4 | 19 | 51 | 10 | 1 | 1 | | | |
| E | 4 | 19 | 51 | 19 | 1 | 1 | | | |

Frame Clearances
 Vert. Clearance at member 1(CX027): 6002
 Finished Floor Elevation = 100000 (Unless Noted Otherwise)

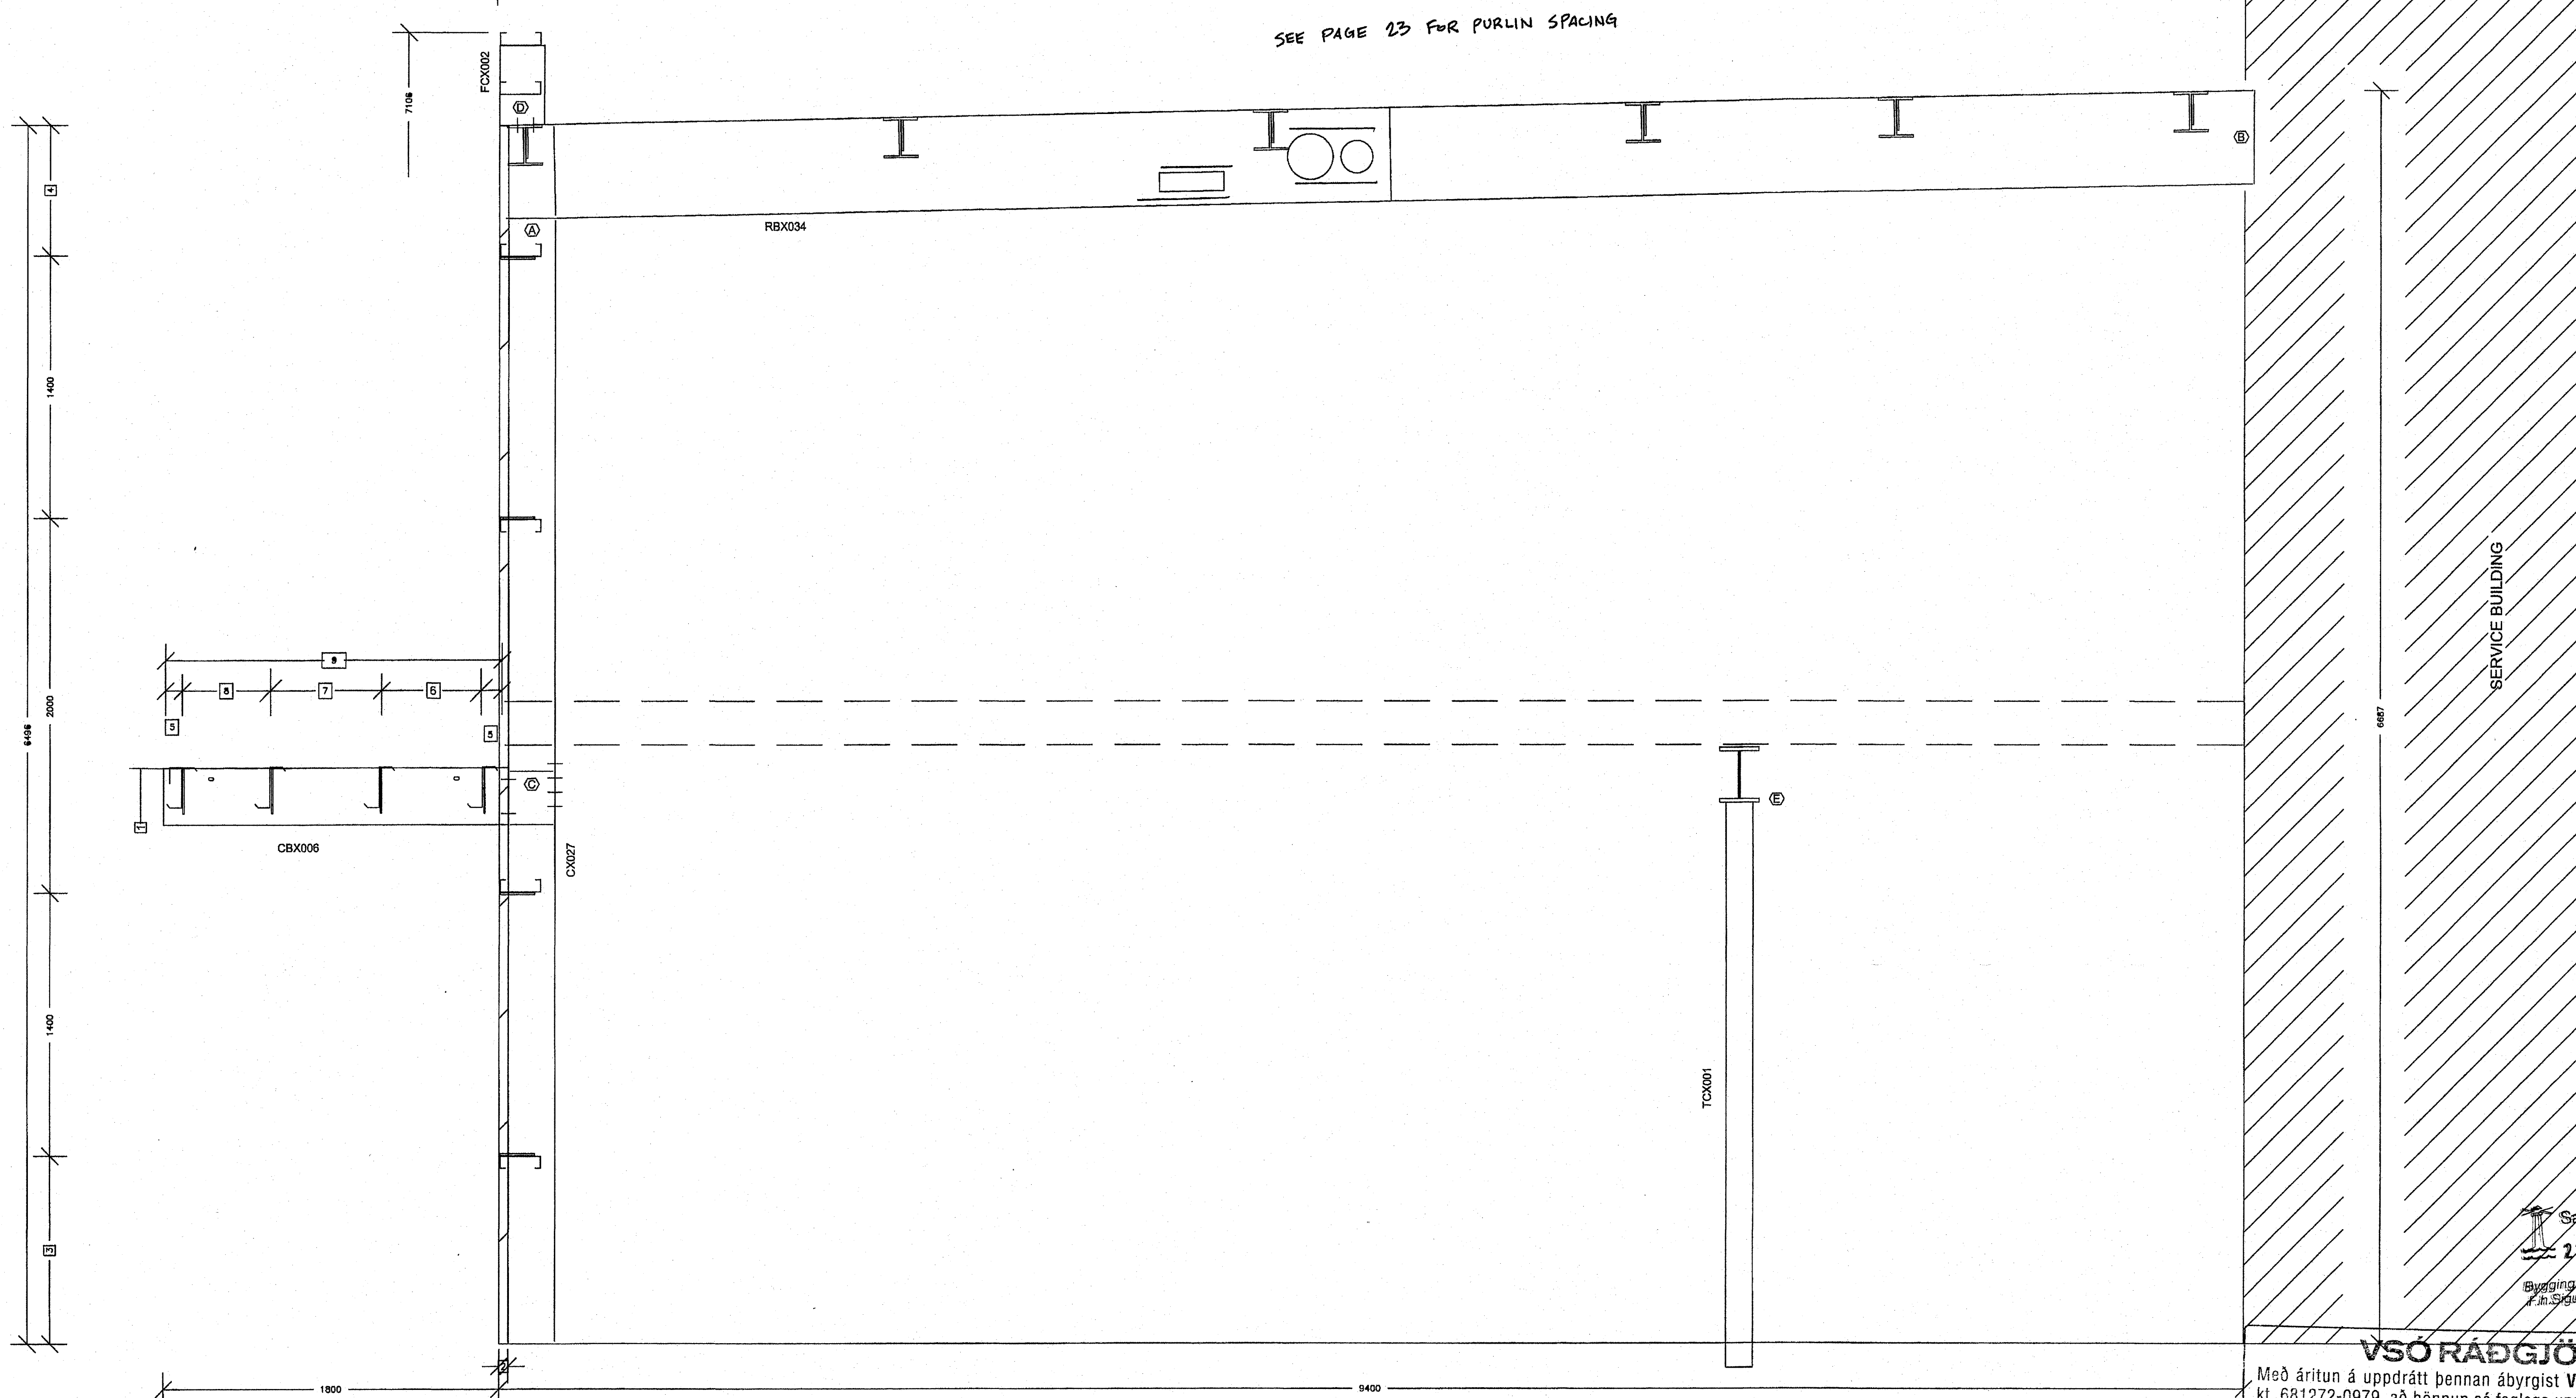

- 9 1800 0.012:10
- 8 497
- 7 571
- 6 554
- 5 89
- 4 695
- 3 1000
- 2 49
- 1 2750

- Dimension Key
- USE 1/2 X 1 1/2 A325 SNUG TIGHTENED BOLTS FOR PURLIN TO FRAME, GIRT TO FRAME, AND GIRT TO CLIP CONNECTIONS UNLESS NOTED OTHERWISE.
 - SLOT REINFORCEMENT PLATES NEED NOT BE LOCATED ON THE SAME SIDE OF THE WEB AS THE HILLSIDE WASHER.

THE VP ENGINEER'S SEAL APPLIES ONLY TO THE WORK PRODUCT OF VP AND DESIGN AND PERFORMANCE REQUIREMENTS SPECIFIED BY VP. THE VP ENGINEER'S SEAL DOES NOT APPLY TO THE PERFORMANCE OR DESIGN OF ANY OTHER PRODUCT OR COMPONENT FURNISHED BY VP EXCEPT TO ANY DESIGN OR PERFORMANCE REQUIREMENTS SPECIFIED BY VP.

THIS DRAWING, INCLUDING THE INFORMATION HEREON, REMAINS THE PROPERTY OF VP BUILDINGS. IT IS PROVIDED SOLELY FOR ERECTING THE BUILDING DESCRIBED IN THE APPLICABLE PURCHASE ORDER AND SHALL NOT BE MODIFIED, REPRODUCED OR USED FOR ANY OTHER PURPOSE WITHOUT PRIOR WRITTEN APPROVAL OF VP BUILDINGS.

THE GENERAL CONTRACTOR AND/OR ERECTOR IS SOLELY RESPONSIBLE FOR ACCURATE, GOOD QUALITY WORKMANSHIP IN ERECTING THIS BUILDING IN CONFORMANCE WITH THIS DRAWING, DETAILS REFERENCED IN THIS DRAWING, ALL APPLICABLE VP ERECTION GUIDES AND INDUSTRY STANDARDS PERTAINING TO PROPER ERECTION, INCLUDING THE CORRECT USE OF TEMPORARY BRACING.

| REV | DATE | BY | DESCRIPTION |
|-----|------|----|-------------|
| | | | |
| | | | |
| | | | |
| | | | |

VP Buildings, Inc.
 3200 Players Club Circle Memphis TN 38125

8/3/2007 9:01:45

FOR CONSTRUCTION

OFFICE FRAME CROSS SECTION AT FRAME LINE(S) 4

Norðurhella 2 - Hafnarfirði
 Stálrammi í línu 4
 Skrifstofuhluti
 Bl. nr. 24

VP BUILDINGS
 VARGO-FRUDEN
 VPC VERSION: 5.6d

JOBN0 07-4487
 DATE 8/14/2007
 DRAWN/CHECK ELM ELM
 PAGE 24

VSO RÁÐGJÖF
 Með áritun á uppdrátt þennan ábyrgist VSO Ráðgjöf ehf. kt. 681272-0979, að hönnun sé faglega unnin og í samræmi við lög og reglugerðir um byggingarmál.

Samþykkt þann 23 JAN. 2008
 Byggingarástjórnir í Hafnarfirði
 P. H. Sigurbjartur Halldórsson